4-Foliit inspection Form					
Insured/Applicant Name: Cante	rbury at Aberdeen Condo Assoc.	Applicatio	n / Policy #:		
Address Inspected: 8018 Aberdee	en Dr , Boynton Beach, FL 33472				
Actual Year Built: 1997	uilt: 1997 Date Inspected: 03/06/2023				
Minimum Photo Requirements ☑ Dwelling: Each side ☑ Roof: E ☑ Main electrical service panel w ☑ Electrical box with panel off ☑ All hazards or deficiencies no					
_			obtained from the Florida licensed professional of e of the suitability, fitness or longevity of any of the		
Electrical System Separate documentation of any alur	minum wiring remediation must be provid	ded and certified by a lice	ensed electrician.		
Type: ☑ Circuit breaker ☐ Fuse Total Amps: 150		Second Panel Type: ☑ Circuit breaker ☐ Fuse Total Amps: 150 Is amperage sufficient for current usage? ☑ Yes ☐ No (explain)			
	g (If present, describe the usage of all ali h) wiring, provide details of all remediation. LUM crimp		tion of all work must be provided.		
Hazards Present Blowing fuses Tripping breakers Empty sockets Loose Wiring Improper grounding Corrosion Over fusing		☐ Double taps ☐ Exposed wiring ☐ Unsafe wiring ☐ Improper breaker size ☐ Scoring ☐ Other (explain)			
General condition of the electrical system: ☑ Satisfactory ☐ Unsatisfactory (explain)					
Supplemental information					
Main Panel	Second Panel		Wiring Type		
Panel age: 1997	Panel age: 2010		☑ Copper ☑ NM, BX or Conduit		
Year last updated: 1997	Year last updated: 2010				

Brand/Model: General Electric

Brand/Model: General Electric

HVAC System					
Central AC: ☑ Yes ☐ No					
Central heat: ☑ Yes ☐ No					
If not central heat, indicate primary heat source and fuel type:					
Are the heating, ventilation and air conditioning systems in good working	order? ☑ Yes ☐ No (explain)				
Date of last HVAC servicing/inspection: 04/01/2021					
Hazards Present					
Wood burning stove or central gas fireplace <i>not</i> professionally installed?	☐ Yes ☑ No				
Space heater used as primary heat source? \square Yes $ old No$					
Is the source portable? ☐ Yes ☑ No					
Does the air handler/condensate line or drain pan show any signs of blockage or leakage, including water damage to the surrounding area?					
Supplemental Information					
Age of system: 2 years					
Year last updated: 2021	win minds.				
(Please attach photo(s) of HVAC equipment, including dated manufacture	r's plate)				
Plumbing System					
Is there a temperature pressure relief valve on the water heater? ☑ Yes	□No				
Is there any indication of an active leak? ☐ Yes ☑ No					
Is there any indication of a prior leak? ☐ Yes ☑ No					
Water heater location: Garage					
General condition of the following plumbing fixtures and connections to applicances:					
Satisfactory Unsatisfactory N/A	Satisfactory Unsatisfactory N/A				
Dishwasher	Toilets				
Refrigerator ☑ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐	Sinks ☑ □ □ Sump pump □ ☑				
Washing Machine Water Heater Water Heater Water Heater Water Heater Water Heater □ □ □ □	Main shut off valve ☑ ☐ ☐				
Showers/Tubs ☑ ☐	All other visible □ □ ☑				
If unsatisfactory, please provide comments/details (leaks, wet/soft spots, mold, corrosion, grout/caulk, etc.).					
Supplemental Information					
Age of Piping System:	Type of pipes (check all that apply)				
X Original to home	☑ Copper				
Completely re-piped	☑ PVC/CPVC				
Partially re-piped Galvanized					
(Provide year and extent of renovation in the comments below)					
	☐ Polybutylene				
	☐ Other (specify)				

Roof (With photos of each roof slope, this section can take the place of the <i>Roof Inspection Form.</i>)					
Predominant Roof Covering material: Clay Tile Roof age (years): 1 Remaining useful life (years): 34 Date of last roofing permit: 06/27/2022 Date of last update: 06/27/2022 If updated (check one):		Secondary Roof Covering material: Modified Bitumen Roof age (years): 25 Remaining useful life (years): 0 Date of last roofing permit: 05/22/1998 Date of last update: 05/22/1998 If updated (check one):			
☑ Full Replacement ☐ Partial Replacement % of replacement		☑ Full Replacement ☐ Partial Replacement % of replacement			
Overall condition:		Overall condition:			
☑ Satisfactory ☐ Unsatisfactory (explain below)		☑ Satisfactory ☐ Unsatisfactory (explain below)			
Any visible signs of damage / deterioration? (check all that apply and explain below) Cracking Cupping/Curling Excessive granule loss Exposed asphalt Exposed felt Missing/loose/cracked tabs or tiles Soft spots in decking Visible hail damage No roof cover Wood rot Water Ponding Debri Granule Loss Any visible signs of leaks Yes No Interior ceilings Yes No		Any visible signs of damage / deterioration? (check all that apply and explain below) Cracking Cupping/Curling Excessive granule loss Exposed asphalt Exposed felt Missing/loose/cracked tabs or tiles Soft spots in decking Visible hail damage Water Ponding Granule Loss Any visible signs of leaks Yes No Attic/underside of decking Yes No Interior ceilings Yes No			
Additional Comments/Observations(use additional pages if needed):					
All 4-Point Inspection Formsmust be completed and signed by a verifiable Florida-licensed inspector. I certify that the above statements are true and correct.					
Nostandy Gonzalez	Home Inspector	HI14832	02/17/2023		
Inspector Signature	Title	License Number	Date		
South Florida Inspectors	Home Inspector	786-218-2844	-		
Company Name	License Type	Work Phone	· ·		

Special Instructions: This sample *4-Point Inspection Form*includes the minimum data needed for Underwriting to properly evaluate a property application. While this specific form is not required, any other inspection report submitted for consideration must include at least this level of detail to be acceptable.

Photo Requirements

Photos must accompany each 4-Point Inspection Form. The minimum photo requirements include:

- · Dwelling: Each side
- Roof: Each slope
- · Plumbing: Water heater, under cabinet plumbing/drains, exposed valves
- · Open main electrical panel and interior door
- · Electrical box with the panel off
- Allhazards or deficiencies

Inspector Requirements

To be accepted, all inspection forms must be completed, signed and dated by a verifiable Florida-licensed professional. Examples include:

- · A general, residential, or building contractor
- · A building code inspector
- A home inspector

Note: A trade-specific, licensed professional may sign off only on the inspection form section for their trade. (e.g., an electrician may sign off only on the electrical section of the form.)

Documenting the Condition of Each System

The Florida-licensed inspector is required to certify the condition of the roof, electrical, HVAC and plumbing systems. *Acceptable Condition* means that each system is working as intended and there are no visible hazards or deficiencies.

Additional Comments or Observations

This section of the 4-Point Inspection Formmust be completed with full details/descriptions if any of the following are noted on the inspection:

- Updates: Identify the types of updates, dates completed and by whom
- · Any visible hazards or deficiencies
- · Any system determined not to be in good working order

Note to All Agents

The writing agent must review each *4-Point Inspection Form* before it is submitted with an application for coverage. It is the agent's responsibility to ensure that all rules and requirements are met before the application is bound. Agents may not submit applications for properties with electrical, heating or plumbing systems not in good working order or with existing hazards/deficiencies.

Photos, Additional Comments or Observations

Exterior Photos




Electrical System

Panel Photos





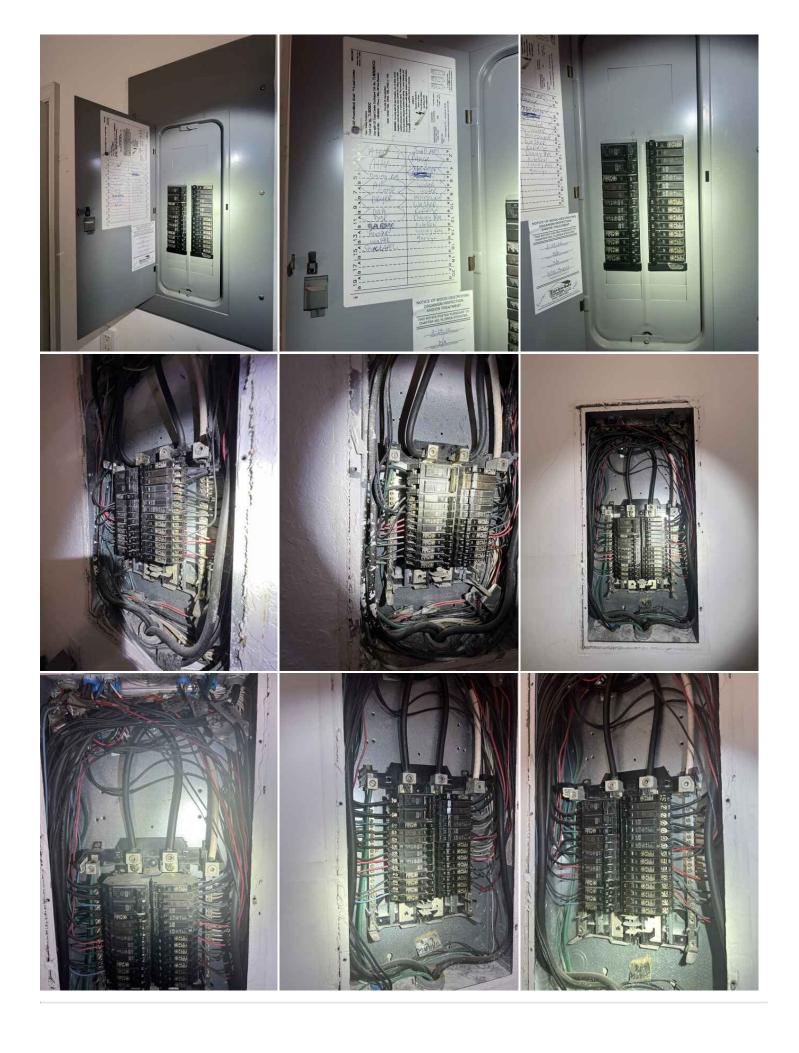

HVAC System

HVAC Equipment






Plumbing System

Water Heater








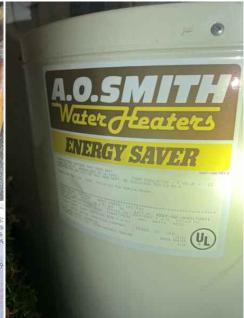

Under cabinet plumbing & drains





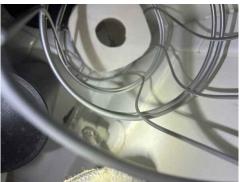








Exposed Valves

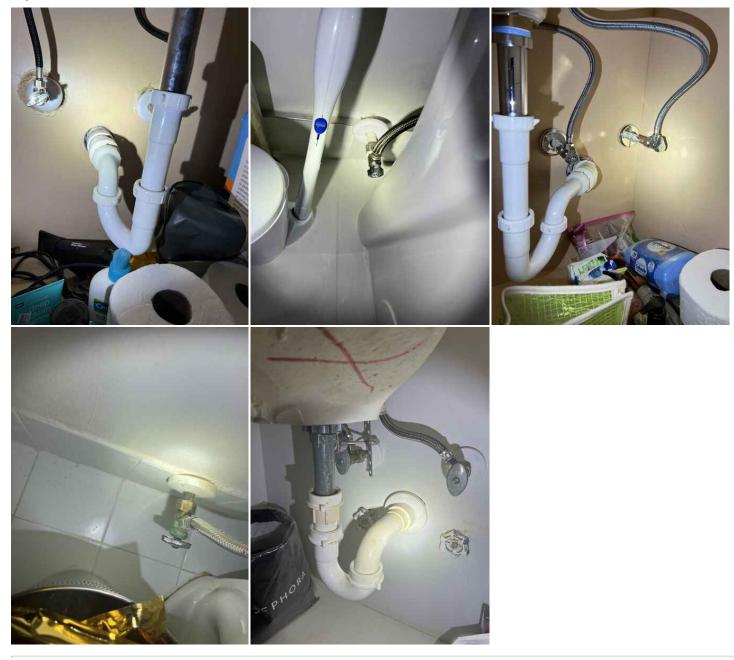

Roof

Photos of Each Slope







